


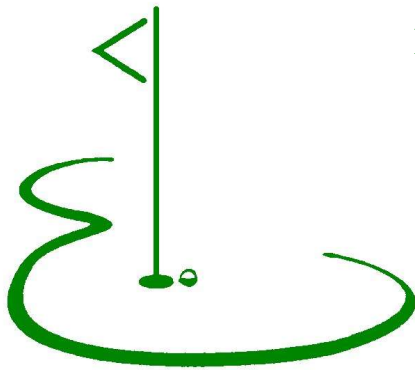

BROOKSIDE LABORATORIES, INC.
GEOTECHNICAL DIVISION
200 WHITE MOUNTAIN DRIVE
NEW BREMEN, OH 45869

**** PHYSICAL ANALYSIS REPORT ****

Braemar Country Club
4001 Reseda Blvd
Tarzana, CA 91356

File Number: 76278

Date Received/Started : 4/19/2023
Date Completed/Reported: 4/21/2023
Date Issued: 4/21/2023

Submitted By: Soil and Water Consulting

Lab Number	0014
Sample Description	DRIVING RANGE FLOOR NEW
Sample Condition	<u>XX</u> Normal ___ Other (see comments)

Method References

ASTM F1632
ASTM F1647 - Method A

D Values

** D10: 0.05
** D60: 0.11
** Coefficient of Uniformity: 2.30

** NON A2LA ACCREDITED
* *This report may only be reproduced in its entirety.*
* *These results represent the sample submitted only.*

**** PHYSICAL ANALYSIS REPORT ****

Braemar Country Club
4001 Reseda Blvd
Tarzana, CA 91356

File Number : 76278
** Date of Analysis **
Start Date : 4/19/2023
Completed : 4/21/2023

Submitted By: Soil and Water Consulting

Lab Number	0014
Sample Description	DRIVING RANGE FLOOR NEW

Particle Size Analysis

Clay	<.002mm	%	20.30
Silt	.002mm - .05mm	%	28.30
Sand	.05mm - 2.00mm	%	31.6
Gravel	> 2.0mm	%	19.8

Org Mat 360 deg C (LOI)	1.45
-------------------------	------

Sand Fractions

Sieve Size			% Retained
#	mm		
10 -	2.0	Fine Gravel	19.8
18 -	1.0	Very Coarse Sand	4.9
35 -	.500	Coarse Sand	4.0
60 -	.250	Medium Sand	4.4
100 -	.150	Fine Sand	3.6
140 -	.106	Very Fine Sand	4.0
270 -	.053	Very Fine Sand	10.6
